
MARION COUNTY SURVEYOR'S OFFICE

DEBRA S. JENKINS MARION COUNTY SURVEYOR SEC. $22\,\mathrm{TWN}.~14_{\mathrm{N}}\,\mathrm{RNG}.~5_{\mathrm{E}}$

BRYAN F. CATLIN, PLS TECHNICAL SUPERVISOR

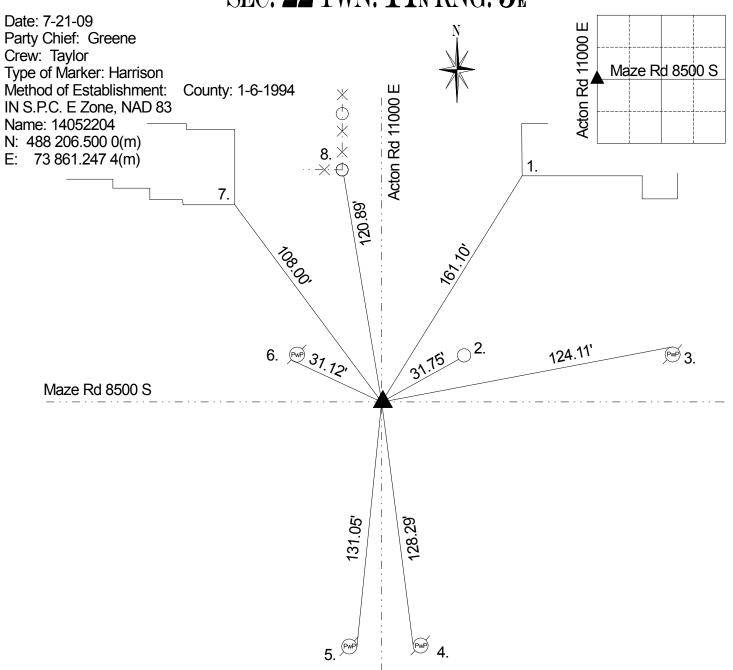

Original post set 1820 by Hendricks with witnesses: 8" beech S 32 E 22 links, 5" dogwood N 28 W 31 links per Marion County Atlas pg. 13. No reference to corner found in Franklin Township Legal Survey book. 11-12-1959 MCS called steel pin over stone 6" down. 5-10-72 MCS called PK nail over stone 10" down. Excavated 9-16-88 and PK nail fd at surface, 1" iron pin fd 6" down over stone 14" down. Stone found .10' S and .10' E of PK nail at surface. Harrison set. Retied 10-28-1998 by Kiste. Re-tied 7-21-2009 by Greene.

REF.	DISTANCE	DESCRIPTION
1.	161.10'	SW garage 11002 Maze Rd
2.	31.75'	Face of pillar
3.	124.11'	PK nail N PwP #1-801 E 12" up
4.	128.29'	PK nail W PwP #71-831 E 12" up
5.	131.05'	PK nail E PwP #19-830 12" up
6.	31.12'	Mag nail w/ brass washer S PwP #21-801 D 20" up
7.	108.00'	SE house corner 10999 Maze Rd
8.	120.89'	Face of steel fence post